


How to enter the project screen when it can't run?

If TK HMI cannot enter the project on the startup interface, and there is no response when click the hmi to enter the project screen.

1) Wiring: Customize cable as below,

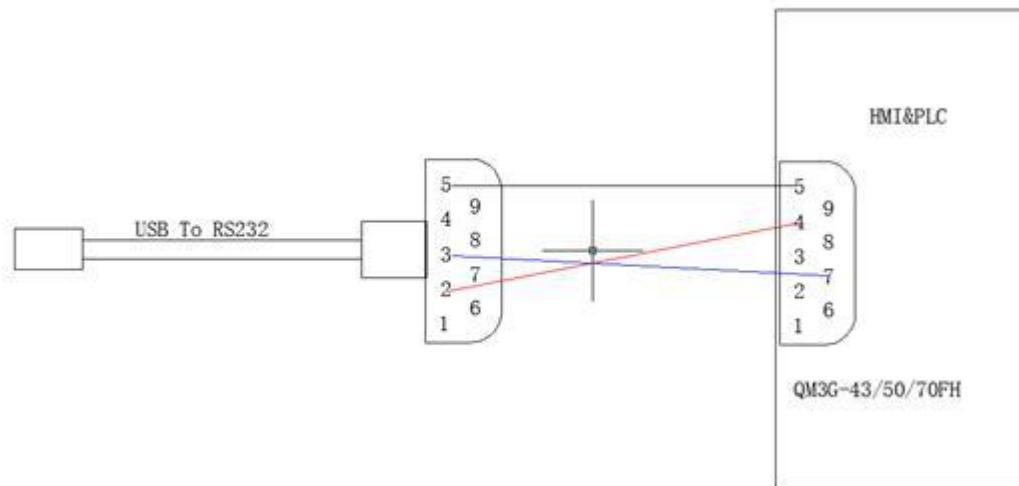

2) After booting up, quickly click the touch screen to enter the project mode, connect to the serial port assistant (available with this software: UartAssist), set OP 115200/8/n/1, send "C0 00 74 08 00 FE 47 C0", This command is used to clear the user program. After success, the touch screen will return the same command, namely "C0 00 74 08 00 FE 47 C0".

3) Re-power on, boot into the prompt to download the project, you can use USB to download the program again.